






HEX NIPPLE

BS3799-1974

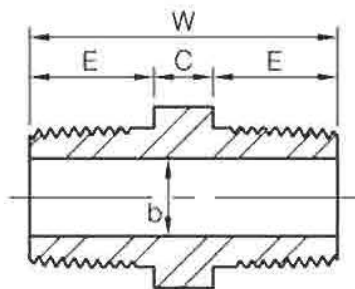

FULL SIZE

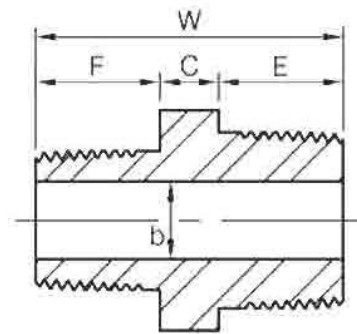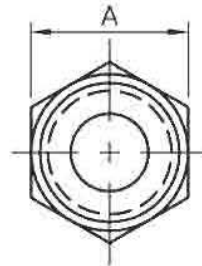

REDUCING SIZE

Dimensions in Millimeters.

Nominal Size				A (Min)	W (Min)	E (Min)	b ⁽¹⁾		C (Min)	F (Min)
Equal		Reducing					3M ⁽²⁾	6M ⁽²⁾		
In	DN	In	DN							
1/8	(6)	—	—	11	26	10	5	2	6	—
1/4	(8)	— 1/4 x 1/8	— (8 x 6)	15 15	36 31	15 15	8 5	6 2	6 6	— 10
3/8	(10)	— 3/8 x 1/4	— (10 x 8)	18 18	40 39	16 16	11 8	8 6	8 8	— 15
1/2	(15)	— 1/2 x 3/8 1/2 x 1/4	— (15 x 10) (15 x 8)	22 22 22	48 44 43	20 20 20	14 11 8	11 8 6	8 8 8	— 16 15
3/4	(20)	— 3/4 x 1/2 3/4 x 3/8	— (20 x 15) (20 x 10)	27 27 27	52 50 46	21 21 21	19 14 11	13 11 8	10 9 9	— 20 16
1	(25)	— 1 x 3/4 1 x 1/2	— (25 x 20) (25 x 15)	35 35 35	60 56 55	25 25 25	24 19 14	17 13 11	10 10 10	— 21 20
1-1/2	(40)	— 1-1/2 x 1 1-1/2 x 3/4 1-1/2 x 1/2	— (40 x 25) (40 x 20) (40 x 15)	50 50 50 50	68 67 63 62	26 26 26 26	38 24 19 14	30 17 13 11	16 16 16 16	— 25 21 20
2	(50)	— 2 x 1-1/2 2 x 1 2 x 3/4 2 x 1/2	— (50 x 40) (50 x 25) (50 x 20) (50 x 15)	62 62 62 62 62	71 70 70 65 65	27 27 27 27 27	49 38 24 19 14	39 30 17 13 11	17 17 18 17 18	— 26 25 21 20

(1) Tolerance See page 19.

(2) 3M & 6M Symbols denote 3000 & 6000 Classes.